General Version 1.2

C3H8-S3 is a popular small size and cost-effective Propane gas sensor module with excellent performance. Rapid detection of Propane gas leaks is possible while maintaining high accuracy over a wide temperature range. In addition, NDIR can be used for more than 10 years in a stable state for a long time.

ELT Sensor Data Sheet for C3H8-S3



Features

- Non-Dispersive Infrared (NDIR) Single Channel
 Technology to measure propane gas levels.
- Excellent compensation of Temperature Effect on propane gas (C3H8) concentration.
- Output: TTL-UART, I2C, ALARM,
 Analog Voltage or PWM is optional.
- Simple Calibration with Non-Periodic Manual
 Calibration (0_MCDL : CAL1) and Periodic
 Automatic Calibration (0_ACDL : CAL2).

• Size: 33mmx33mmx13.1mm

• Weight: 10 grams

Specifications

Applications

A Gas leakage alarming detector or equipment of Propane gas or so.

General Performance

Operating Temperature : -20 ~ 50°C

Operating Humidity: 0 ~ 95% RH (Non-condensing), 0 ~ 99% RH (Non-condensing) (1)

Storage Temperature : -30°C ~70°C

Measurement

Sensing Method: NDIR (Non-dispersive Infrared)

Measurement Range : 0 ~ 100%LEL (=0~21,000ppm is optional)

Output: % LEL (default), ppm (option).

Accuracy: ±3% of F.S. (2),(3),(4)

Resolution: 1% LEL (=210ppm vol.)

Detection Limit: 2% LEL (=420ppm vol.),

Step Response Time (90%, 1/e): 100 seconds / 70 seconds (Diffusion)

Sampling Interval: 3 seconds

Warming-up Time: < 6 seconds (for Detection), 5 minutes (for Accuracy)

Electrical Data

Power Input: $5V \pm 5\%$ ⁽⁵⁾

Current Consumption: Normal mode: 12mA, Peak: 240mA, Sleep < 0.5mA

Product Derivatives and Relative Functions

Products	Feature	Option			
C3H8-S3	8-S3 UART,I2C, ALARM, PWM, 0_MCDL(CAL1)/0_ACDL(CAL2)				
C3H8-S3 G	Resistant up to 99% Humidity for Application	C3H8-S3 G -3V			

C3H8-S3 has various output TTL-UART, I2C, ALARM while as PWM or Analog voltage is selectable as option. 2.54pitch 13pin side-hole connector besides 2mm pitch 10 and 4pin 2 row

⁽¹⁾ C3H8-S3G: 0 ~ 99% RH (Non-condensing) for Industrial Application of Propane gas.

^{(2) 2%} should be added for absolute measurements for uncertainty of calibration gas mixture unless '0' ppm or '0'ppm standard gas calibration is done.

⁽³⁾ Air pressure is assumed as 101.3 kPa.

⁽⁴⁾ If sensor is affected by the shock, may need field calibration before installation.

⁽⁵⁾ DC Supply should be regulated without ripple < 100mV, low noise power source is needed for best accuracy.

header connectors.

Pin Map with J11&J12 Connectors

J-11	Description
1/3	VDD (+5VDC)
2/4	GND

J-12	C3H8-S3	C3H8-S3 (Analog Voltage Option)					
1	TTL RXD (← CPU	of Master Board)					
2	TTL TXD ($ ightarrow$ CPU	of Master Board)					
3	I2C SCL						
4	I2C SDA						
5	GND						
6	Reserved	Analog Voltage Output (0.5~4.5V)					
7	CAL2-pin: 0_ACDL (for every 7 days ACDL with periodic C3H8-'0'ppm circumstance)						
8	Reserved						
9	CAL1-pin: 0_MCDL (for 10 minutes MCDL with C3H8-'0'ppm- N2-based-gas or Fresh Air)						
10	Reset (Lo	w Active)					

UART 38,400BPS, 8bit, No parity, 1 stop bit

9,600 or 19,200 BPS can selectable through command sets or EK-100SL.

I2C Slave mode only, Internal pull up resister 10kΩ

TTL Level Voltage : $0 \le V_{IL} \le 0.8$, $2 \le V_{IH} \le V_{DD}$, $0 \le V_{OL} \le 0.4$, $2.4 \le V_{OH} \le V_{DD}$ (Volt)

ALARM: Open Collector type.

ex) Alarm_On: 25% LEL, Alarm-Off: 20% LEL


Analog Voltage: 0.5~4.5V (option)

PWM (option)

 t_H = 2 msec(Start) + 1,000 msec x (Measurement_(ppm)/ Range_(ppm)), T_L = 2,000 ms - t_H ,

Dimensions (unit:mm)

Dimensions unit: mm

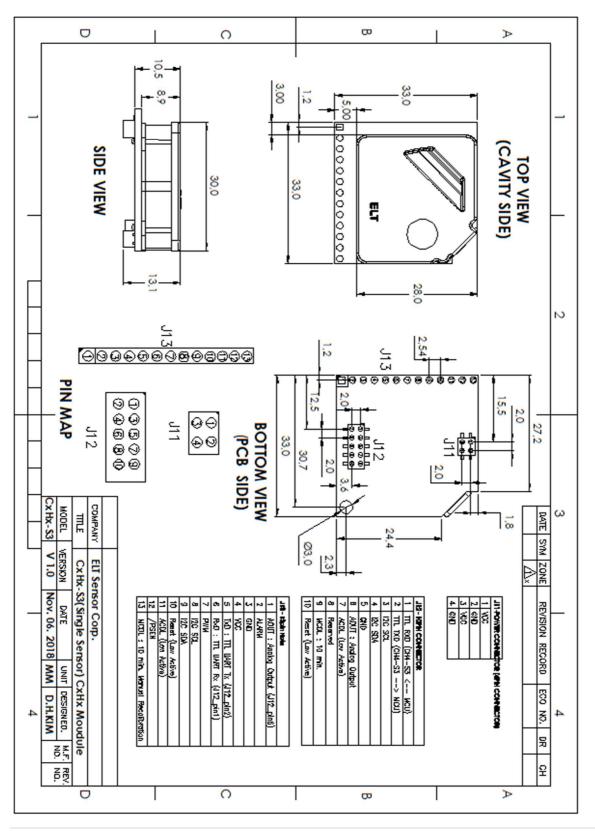


Pin Map with J13 Connectors

J-13	C3H8-S3	C3H8-S3 (PWM/Analog Voltage Option)							
1	Reserved	Analog Voltage Output (0.5~4.5V)							
2	Alarm (Ope	en Collector)							
3	G	ND							
4	VDD (·	+5VDC)							
5	TTL TXD ($ ightarrow$ CPU	TTL TXD (→ CPU of Master Board)							
6	TTL RXD (← CPU of Master Board)								
7	Reserved	PWM Output (TTL)							
8	I2C	I2C SCL							
9	I2C	I2C SDA							
10	Reset (Low Active)								
11	CAL2-pin (for every 7 days ACDL with periodic C3H8-'0'ppm circumstance)								
12	Res	Reserved							
13	CAL1-pin (for 10 minutes MCDL with C	3H8-'0'ppm-N2-based-gas or Fresh Air)							


0_MCDL (2 minutes Manual Calibration)

'0' ppm Manual Calibration can be done by giving start command or low signal to CAL1-pin at least more than 10 minutes since the fresh air is fully balanced near sensor.

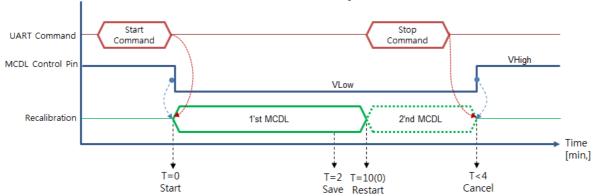

0_ACDL (Periodic Automatic Calibration)

'0' ppm Periodic Automatic Calibration can be used by giving start command or low signal to CAL2-pin. The sensor calibrate automatically first in 2 days, seconds 5 days and every week. '0'ppm Standard Gas can be used when the place doesn't face free air during the period.

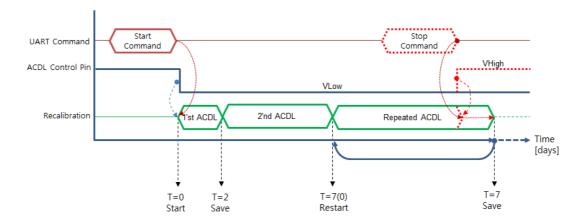

- Method 1. UART Command Set; J12: pin-1 (UART-RX) and pin-2 (UART-TX) to Main-Board (J13: pin-5 and pin-6 are available as well.).
- Method 2. I2C Command Set; J12: pin-3 (SCL) and pin-4 (SDA) to Main-Board. (J13: pin-8 and pin-9 are available as well.)
- Method 3. Let Sensor install on Jig Board, **TRB-100ST (Test and Recalibration Board)** with ambient air-flow condition or with 0'ppm Standard Gas and execute by moving jumper following Manual on the website.
- Method 4. Send string command set below to RXD-pin of Sensor on Emulation program. **EK-100SL (Evaluation kit, with Emulation program 'ELTWSD')** is available

Method 5. CAL1 / CAL2-pin settings for 0_MCDL / 0_ACDL

CAL1 0_MCDL	CAL 2 0_ ACDL	Function	Process
Low	High	H/W '0'ppm MCDL	Let C3H8-S3 sensor be located at ambient place where no Propane gas exist and wait 2 minute. '0'ppm Standard gas can be used when '0'ppm is not guaranteed.
High	Low	H/W '0' ppm ACDL	Automatic Calibration can be used where propane sensor faces the clear air more than 3 minutes per week.
High	High	Normal	Operate with Factory Calibrated or previously set status

- X 1. CAL-1pin and CAL-2pin shouldn't have 'Low' at the same time.
 - 2. Be sure to escape MCDL fetch loop between 2 minutes and 4minutes to avoid inappropriate calibration.

Output Descriptions

UART Descriptions

Data Format

SP	SP	SP	D2	D1	'%'	SP	'L'	'E'	'L'	CR	LF
		SP x	3				Sp	ace: (0x20		
D2 ~ D1											
%							(% : 0x	:25		
SP							Sp	ace: (0x20		
'LEL'							' l	_EL′s	tring		
CR						Carriage return : 0x0D					
LF							Line	feed	: 0x0A	١	

Above 12byte consist by 2 byte hexadecimal digits, <SP>,<SP>,<SP>, D2, D1, 0x25, <SP>, 'L', 'E', 'L', <CR><LF>, where decimal '0' (corresponds to hexadecimal digit '0x30') is replaced by space (corresponds to hexadecimal digit '0x20'),

EX) 7% LEL (= 3,500 ppm) string is '0x20 0x20 0x20 0x20 0x37 0x25 0x20 0x4C 0x45 0x4C, 0x0D 0x0A',, of which display on the screen is '_____7%_LEL<CR><LF>'.

'ppm' display is Option on sale, which D6~D1 string display the propane gas concentration of

D6	D5	D4	D3	D2	D1	SP	'p'	'p'	'm'	CR	LF
----	----	----	----	----	----	----	-----	-----	-----	----	----

EX) 3,500 ppm string is $'0x20\ 0x20\ 0x33\ 0x35\ 0x30\ 0x20\ 0x70\ 0x70\ 0x6D\ 0x0D\ 0x0A',$ of which display on the screen is $'_3500_ppm < CR > < LF >'$.

I2C Communication (Only Slave Mode Operation)

Internal pull up resister 10kΩ


Slave Address: 0x31, Slave Address Byte: Slave Address(0x31) 7 Bit + R/W 1 Bit

Bit7	Bit6	Bit5	Bit4	Bit3	Bit2	Bit1	Bit0
0	1	1	0	0	0	1	R/W Bit

R/W Bit: Read = 1/Write = 0

When reading the data, Slave Address Byte is 0x63, When writing the data, Slave Address Byte is 0x62.

Block Diagram

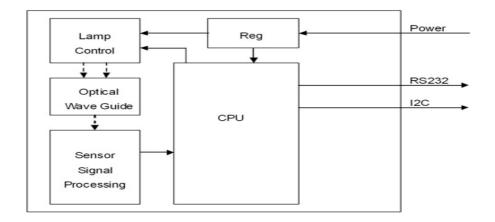

Transmission Sequence in Master


- 1) I2C Start Condition
- 2) Write Command(Slave Address + R/W Bit(0) = 0x62) Transmission and Check Acknowledge
- 3) Write Command(ASCII 'R': 0x52) Transmission and Check Acknowledge
- 4) I2C Stop Command
- 5) I2C Start Command
- 6) Read Command(Slave Address + R/W Bit(1) = 0x63) Transmission and Check Acknowledge
- 7) Read 7 Byte Receiving Data from Module and Send Acknowledge (Delay at least 1ms for reading each byte)

Header	CH4	reserved	reserved	Reserved	reserved					
1 Byte	2 Byte	0x00	0x00	0x00	0x00					
0 0 0	0 1 0 0	0								

In need of detail protocol specification and time sequence, '12C programming guide' could be provided by contacting Sales Rep.

Alarm Descriptions

Alarm signal operates as Open Collector type and send TTL on signal since propane gas sensor measured value beyond 25% LEL until it go down to 20% LEL. It is designed to be activated when sensor's measured value surpass 25% LEL and deactivated down to 20% LEL to avoid unwanted rapid switching by hysteresis effect.

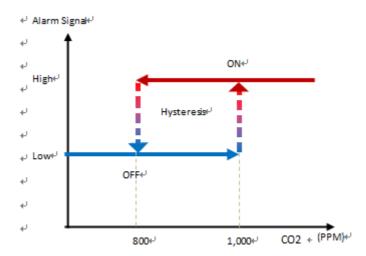


Alarm_On: 25% LEL, Alarm-Off: 20% LEL

EK-100SL series is available for customer to enable to change alarm activation & deactivation point.

PWM Descriptions: Option

- * Measurement_(ppm) = (t_H-2msec)/1000msec x Range_(ppm) (t_H : High Pulse Width)
- * Range(ppm): 0~100% LEL (0~21,000 ppm)

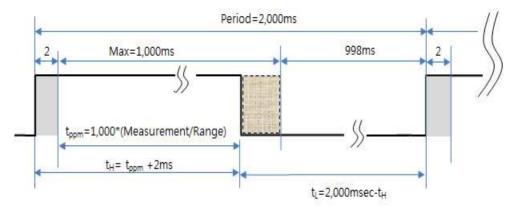

EX) t_H (High Pulse Width) calculation for 50% LEL in 100% LEL Range.

*Measurement(% LEL) = 50% LEL = $(t_H-2ms)/2,000msec \times Range(% LEL)$,

*t_H= 1,000 msec * (50% LEL / 100% LEL) + 2msec = 502msec


(cf: T_L = Period - t_H = 2,000 msec - 502 msec = 1,498 msec.)

Analog Voltage Output Descriptions: Option

Measured Voltage 0.5V~4.5V match proportionally to 0 ~ 100% LEL.

* C3H8 Measurement (ppm) = ((Output voltage- 0.5) / (4.5 - 0.5) voltage) x 100% LEL.

EX) if the Output $_{Voltage}$ is 2.5V in 0~100% LEL range, C3H8 (% LEL) = (2.5 - 0.5) V÷ (4.5 - 0.5)V x 100% LEL = 0.5 x 100% LEL = 50% LEL

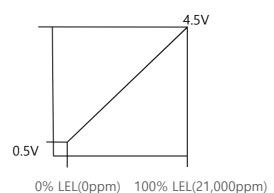

X Caution

- 1. The gold cavity part of the sensor module or the PCB outer part should not touch by the customer's case housing. It causes long-term value fluctuation. Be at least 3 mm apart from the housing.
- 2. When removing and inserting the sensor module, do not hold the gold cavity but hold the PCB on both sides. Put on the electret gloves to prevent the static electricity. (Excessive force on the gold cavity can affect the initial performance and accuracy of the sensor.)
- → If the measured value is wrong, you can calibrate zero point for more than 10 minutes at CAL1 (MCDL) position and use it with high accuracy.
- 3. Do not let water get on, drop, or shock the sensor.
- 4. Do not store the sensors in high temperature and high humidity for long time without applying power. The initial measurement accuracy of the sensor may be affected.
- 5. Be careful not to be affected by static electricity and induction electromagnetic field around sensor.
 - To prevent static electricity from being generated during assembly, wear electrostatic gloves and work on a static-free workbench. (Keep the sensor in the place where the electricity is removed.)
- 6. Install the sensor at a position as far away as possible from the motor or vibration. Vibration or noise may be accuracy affected during sensor operation.

- 7. When using the sensor for the first time or after long term storage, you can use CAL1 MCDL zero point calibration and use it with high accuracy.
- \mathbf{X} Specification of CxHy-S3 Series could be changed without notice.

ELT SENSOR Corp.

Chunui Technopark 101-909) 36, Bucheon-ro 198beon-gil,Wonmi-gu, Bucheon-si, Gyeonggi-do, 420-857,Korea

Phone. +82-32-719-8055, http://www.eltsensor.co.kr

Subject to change without notice. Printed in KOREA 2018 ELT Sensor Corp. All rights reserved.

Nov. 2018.